


VHX-1050/VHX-1060

Dakota Digital Universal VHX Instrument Installation




Installation


1. Use the provided template to mark out the 3 3/8" and 2 1/16" openings needed to fit the VHX displays. Ensure there is adequate clearance behind the desired mounting location. The display units need approximately two inches of depth behind the dash.

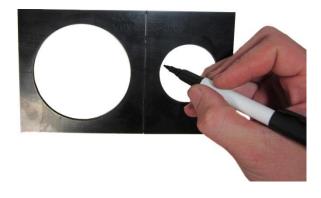

2. With the appropriate openings cut, place the VHX displays into the dash, then slide the gasket and mounting cup over the back of the gauge. Use the appropriate supplied thumb nuts to secure each gauge.




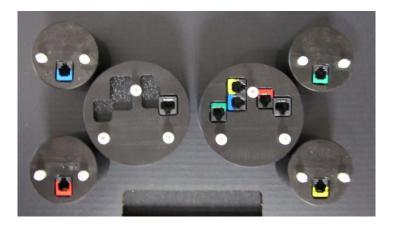

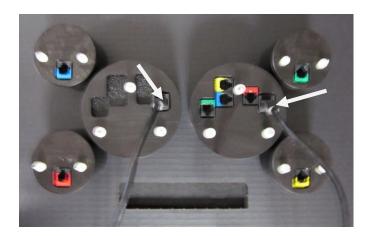

3. Connect the provided CAT5 Cables to the back of the Speed and Tach and carefully route the other ends to the control box mounting location.

4. The auxiliary gauges have color coded connectors and harnesses to simplify connection to the Speed gauge. For example, match the auxiliary gauge with the blue connector to the blue connector on the back of the Speed gauge using the harness marked blue. Repeat with red, yellow, and green harnesses.

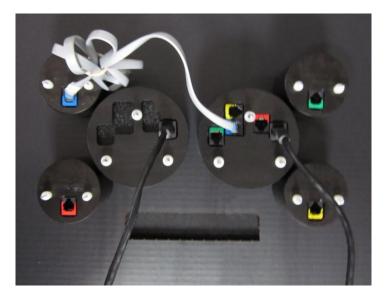

5. Refer to the main manual for wiring instructions to complete the VHX installation.



▲ WARNING: This product can expose you to chemicals including lead, which is known to the State of California to cause cancer and birth defects or other reproductive harm. For more information go to www.P65Warnings.ca.gov



4510 W. 61st St. North
Sioux Falls, SD 57107
www.dakotadigital.com
dakotasupport@dakotadigital.com

Phone (605) 332-6513 Fax (605) 339-4106

© Copyright 2024 - Dakota Digital