



## INSTALLATION INSTRUCTIONS

### LAT-NR221

LED Tail Lights for 1958 Chevy Bel Air/Biscayne  
and 1961-1967 Corvette

MAN#650209

### Kit Includes:



### Installation:


1. Remove the two screws and tail light lens.



2. Remove the light bulb.
3. Push and twist to remove the plastic wire socket from the back side of the housing.



4. Now is a good time to clean the lens and housing. If lenses are in bad shape a new set is recommended.
5. Remove the nut and round metal spacer from the back of the new LED assembly.

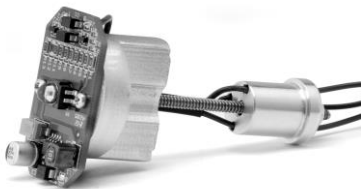


6. Insert the new LED assembly through the hole where the original bulb and connector were. Gently pull the wires through the opening to avoid damaging the wire insulation.



7. Feed the wires through the round metal spacer, with one wire going through each outer hole in the aluminum spacer. Use caution when feeding wires through to avoid damaging the wire insulation. The larger diameter ring should be away from the tail light housing.



8. Secure the metal spacer with the supplied #6 nut.

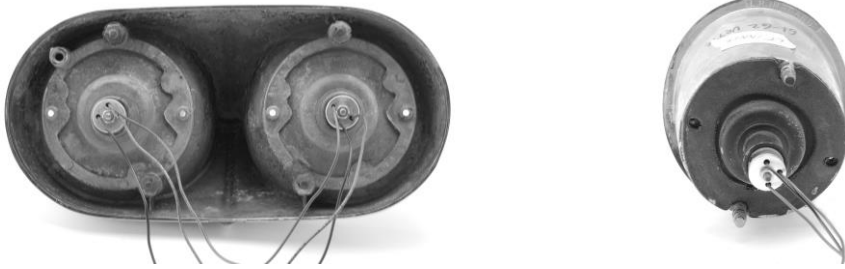

9. Make sure the original lens gasket is in place and replace the tail light lens. Tighten the screws down carefully.


10. Cut off the existing light socket as it will not be used. Do not strip the wires. Trim the wires from LED assembly to appropriate length, once mounted, making sure wires are routed cleanly and securely.

11. Use the supplied moisture resistant pigtail connectors\* to attach the wires from the new LED assembly to the existing vehicle harness. Insert appropriate wire from vehicle harness and mating LED assembly wire into a connector and crimp following instructions below.

\*For the best connection, soldering is recommended. But to simplify installation, the supplied connectors will provide a fast weather resistant connection.

**The correct crimp method for the supplied connectors is:**

- 1.) Insert **UNSTRIPPED** wires into the connector and ensure they are all they way in by observing the clear bottom of the connector to see the wires are touching the end.
- 2.) Use pliers to push the blue cap down flush with the edge of the clear body, completing the connection. The connection will only be correct if pressed firmly down with pliers.

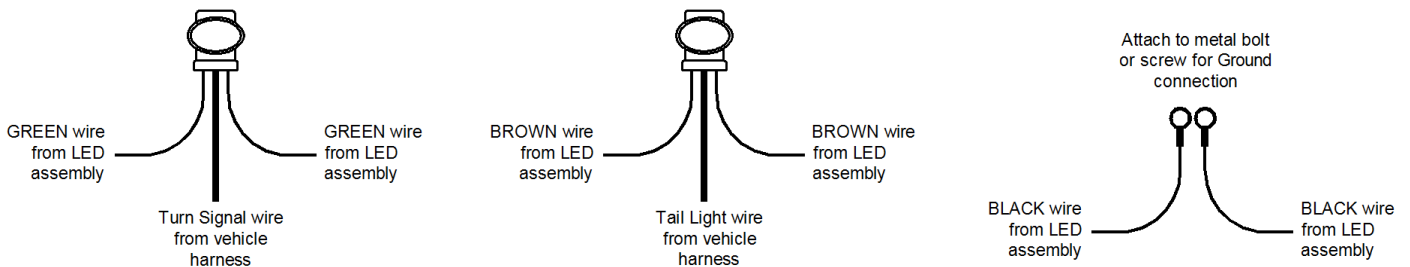

	LED wires	Vehicle harness
<b>Tail light</b>	Brown	Brown or Black
<b>Driver's Turn</b>	Green	Green or Pink
<b>Passenger's Turn</b>	Green	Yellow or Purple
<b>Ground</b>	Black	Chassis or body

12. Repeat for the other side.

13. Test the tail lights, brake lights, and turn signals. If the turn signals do not flash you will need to upgrade your flasher. If you are replacing only the rear turn signals you should be able to use a heavy duty electronic flasher from your local parts store. If you are replacing both front and rear or do not have front bulbs you will need a no-load flasher, Dakota Digital part number LAT-NLF.

## **SERVICE AND REPAIR**

DAKOTA DIGITAL offers complete service and repair of its product line. In addition, technical consultation is available to help you work through any questions or problems you may be having installing one of our products. Please read through the Troubleshooting Guide. There, you will find the solution to most problems.

**Should you ever need to send the unit back for repairs, please call our technical support line, (605) 332-6513, to request a Return Merchandise Authorization number.** Package the product in a good quality box along with plenty of packing material. Ship the product by UPS or insured Parcel Post. Be sure to include the RMA number on the package, and include a complete description of the problem with RMA number, your full name and address (street address preferred), and a telephone number where you can be reached during the day. Any returns for warranty work must include a copy of the dated sales receipt from your place of purchase. Send no money. We will bill you after repair.

### **Dakota Digital Limited Lifetime Warranty**

DAKOTA DIGITAL warrants to the ORIGINAL PURCHASER of this product that should it, under normal use and condition, be proven defective in material or workmanship for the lifetime of the original vehicle it was installed in, such defect(s) will be repaired or replaced at Dakota Digital's option.

This warranty does not cover nor extend to damage to the vehicle's systems, and does not cover removal or reinstallation of the product. This Warranty does not apply to any product or part thereof which in the opinion of the Company has been damaged through alteration, improper installation, mishandling, misuse, neglect, or accident.

This Warranty is in lieu of all other expressed warranties or liabilities. Any implied warranties, including any implied warranty of merchantability, shall be limited to the duration of this written warranty. No person or representative is authorized to assume, for Dakota Digital, any liability other than expressed herein in connection with the sale of this product.

**⚠ WARNING:** This product can expose you to chemicals including lead, which is known to the State of California to cause cancer and birth defects or other reproductive harm. For more information go to [www.P65Warnings.ca.gov](http://www.P65Warnings.ca.gov)



4510 W. 61st St. North  
Sioux Falls, SD 57107  
[www.dakotadigital.com](http://www.dakotadigital.com)

Phone (605) 332-6513  
Fax (605) 339-4106

[dakotasupport@dakotadigital.com](mailto:dakotasupport@dakotadigital.com) Copyright 2011 - Dakota Digital, Inc.