



VHX-66L

Dakota Digital VHX Instrument Installation
For 1966-'69 Lincoln Continental

Your new VHX-66L kit includes:

VHX Display



Switch Assembly



Universal Sender Pack



Installation Manuals



Ford Speed Adapter

(3) 8-32 X 7/8" Screws



(2) 6-32 X 5/8" Screws




CAT5 Cable

(2) 6-32 X 1/4" Screws



Control Box

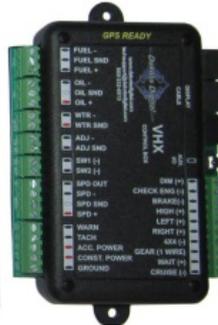

(5) 6-20 X 5/8" Screws



Installation


1. Remove the stock gauge cluster from the dash. Retain all hardware for reassembly.



2. Remove the lower panel on the gauge bezel. Retain all hardware for reassembly.



3. Remove the odometer assembly.

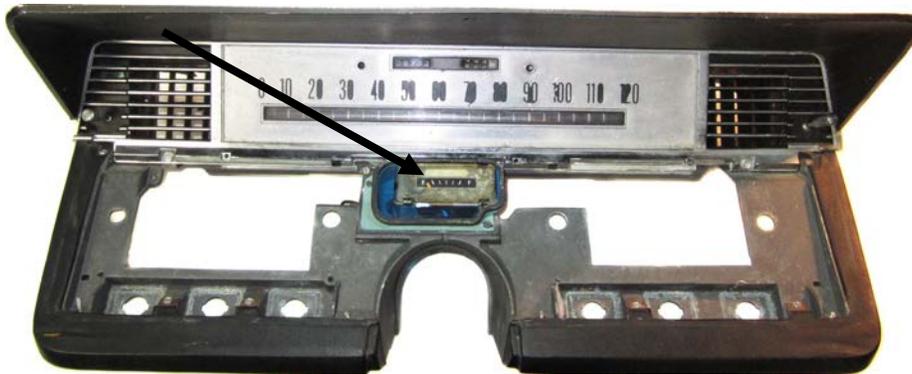

4. Remove the speedometer gauge face.



5. Remove the speedometer assembly so you are left with a bare gauge housing. The blue bulb shields can be left in place or removed if desired.



6. Separate the speedometer face from the gauge trim.



7. Mount the VHX gauge to the gauge trim using the provided three (3) 8-32 X 7/8" screws.





8. Attach the assembled gauge trim to gauge housing using five (5) 6-20 X 5/8" screws.



9. Mount the VHX switch assembly to the gauge housing using the provided two (2) 6-32 X 1/4" screws.



10. Connect the provided switch harness to the back of the VHX switch assembly and refer to the wiring diagram.

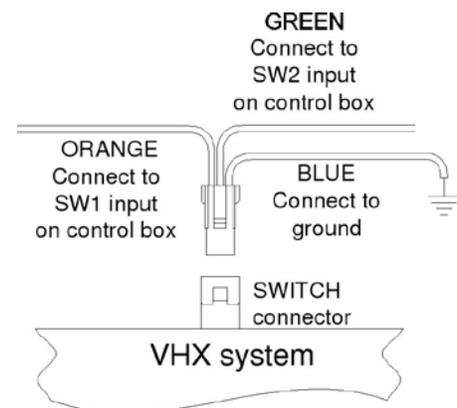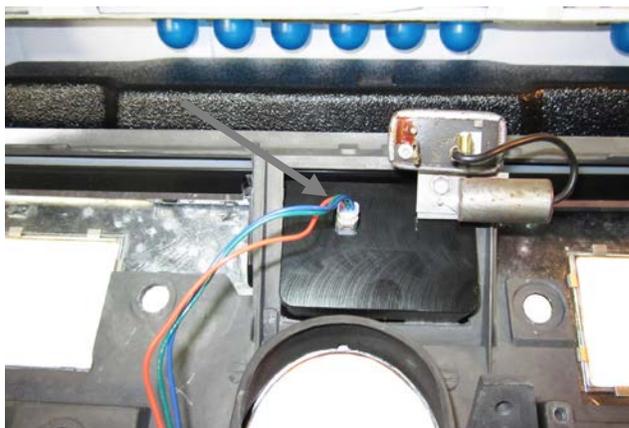

11. Connect the provided CAT5 cable to the back of the VHX gauge.



12. Reinstall the lower panel and the dash is now ready to re-install into the vehicle using stock hardware. Take care when routing the CAT5 cable and switch harness to the control box mounting location. Refer to the main manual to complete the VHX installation.



⚠WARNING: This product can expose you to chemicals including lead, which is known to the State of California to cause cancer and birth defects or other reproductive harm. For more information go to www.P65Warnings.ca.gov



4510 W. 61st St. North
Sioux Falls, SD 57107
www.dakotadigital.com

dakotasupport@dakotadigital.com Copyright 2011 - Dakota Digital, Inc.

Phone (605) 332-6513
Fax (605) 339-4106